

Technical conservation plan for an architectural detail in the Khan El Faranj

Nika Bogdanić Saving the Stones January 2014





Table of contents:

- 1. Introduction
- 2. Background in historical research
- 3. General survey of the architectural elements
- 3.1 Key plan of the architectural elements
- 3.2 Facade map of the architectural elements
- 3.3 Facade map of the stones
- 3.4 Facade map of the mortars
- 3.5 Description and values of the architectural elements
- 3.6 Deterioration patterns
- 4. A specific architectural element (the 1596 inscription)
- 4.1 The 3D model
- 4.2 The building technology of the element
- 4.3 Problems and cuses of the physical condition
- 4.4 Proposed solutions and treatmans

1. Introduction

- The objectve of this work is to prepare a technical conservational plan for an architectural detail in Akko's Khan El Faranj

- The methodology oof the work includes an overview of the Khan El Faranj, the general survey of the architectural elements in the Khan, a choice of a specific architectural element, the graphic information of the element, the state of preservation and the causes, as well as the proposed solutions

2. Background in historical research

- The site where the Khan now sits was first developed in 1110 when King Baldwin I of Jerusalem granted Venice a quarter within the Crusader city. They establihed a guest house for travelling merchants that followed the architetural style of the Levant the caravanserai, or Khan. Nothing from this era still stands

- Later, the French dominate the trade through Akko and in 1610, Khan Franj (the French Khan) was the hub for the cotton trade in the Holy Land

- By the mid 17th century, the Khan was known as the Khan of Ambassadors. The upper floor served as the residence for consuls from around Europe, while the bottom floor retained its commercial use as storage and storefronts


- In the 18th century the European traders no longer operate in Akko

(*for more information about the Khan's history check the project: "Khan El Faranj", by Owen Thompson)



Plan and sections of the town and defences of St.Jean D'Acre (Published by John Weale, 59 High Holborn, June 1, 1843)




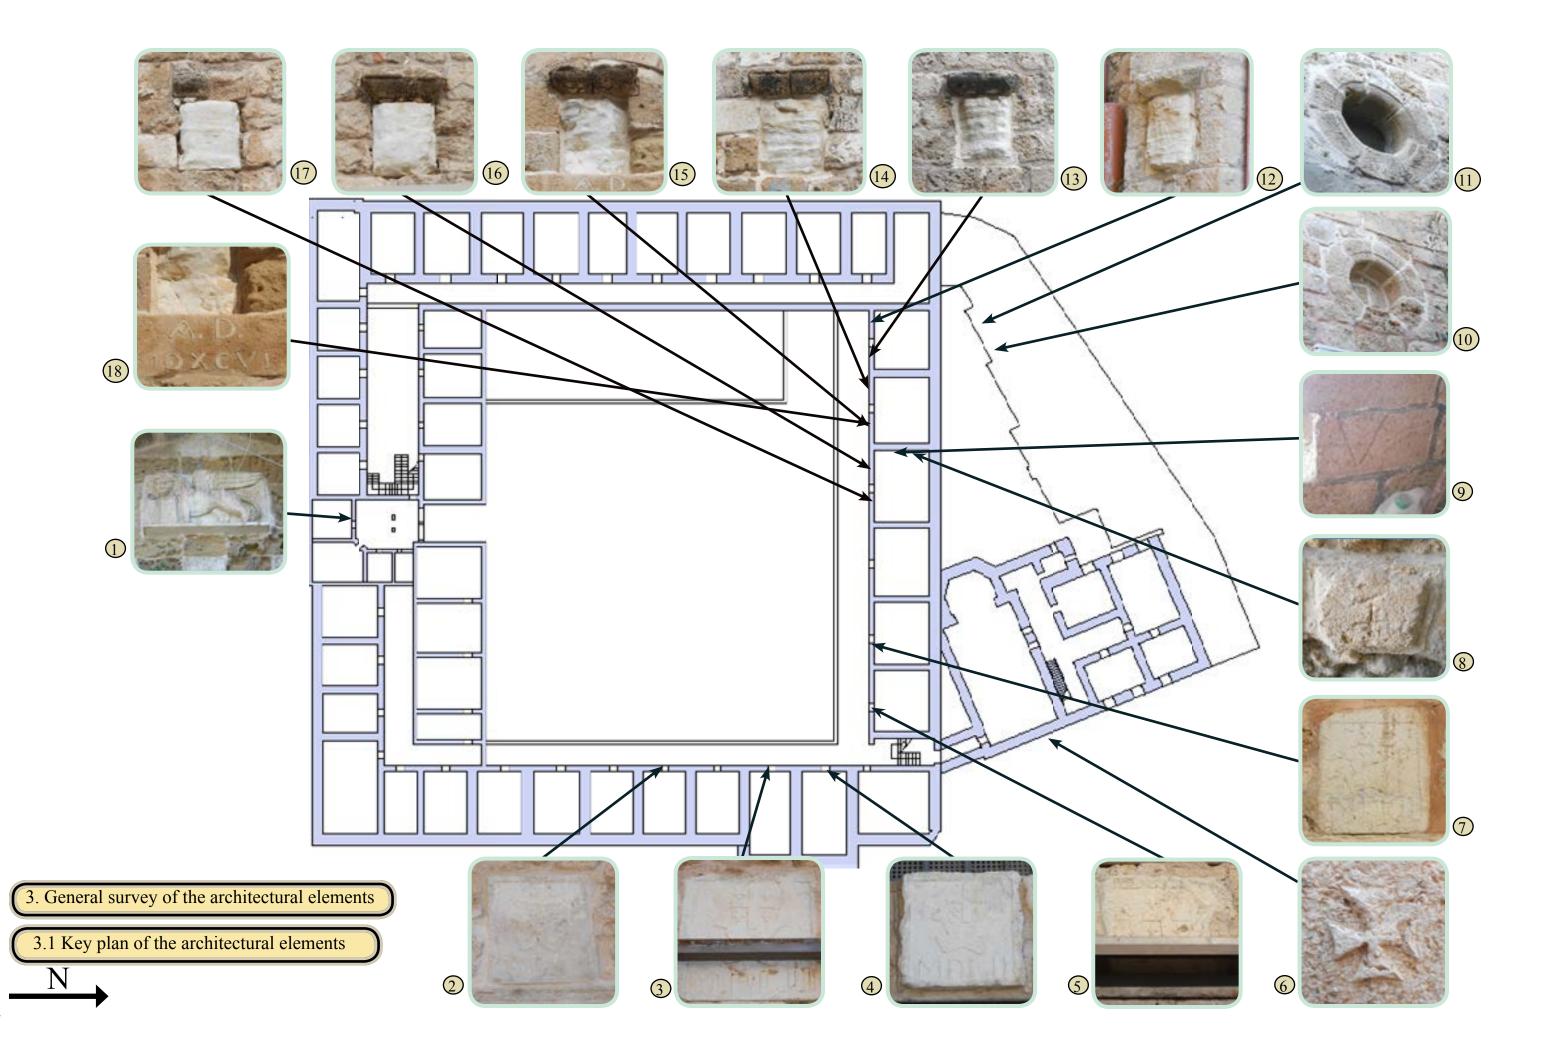

3.2Facade map of the architectural elements

North facade

6 identical pilars set on the same height of the north facade

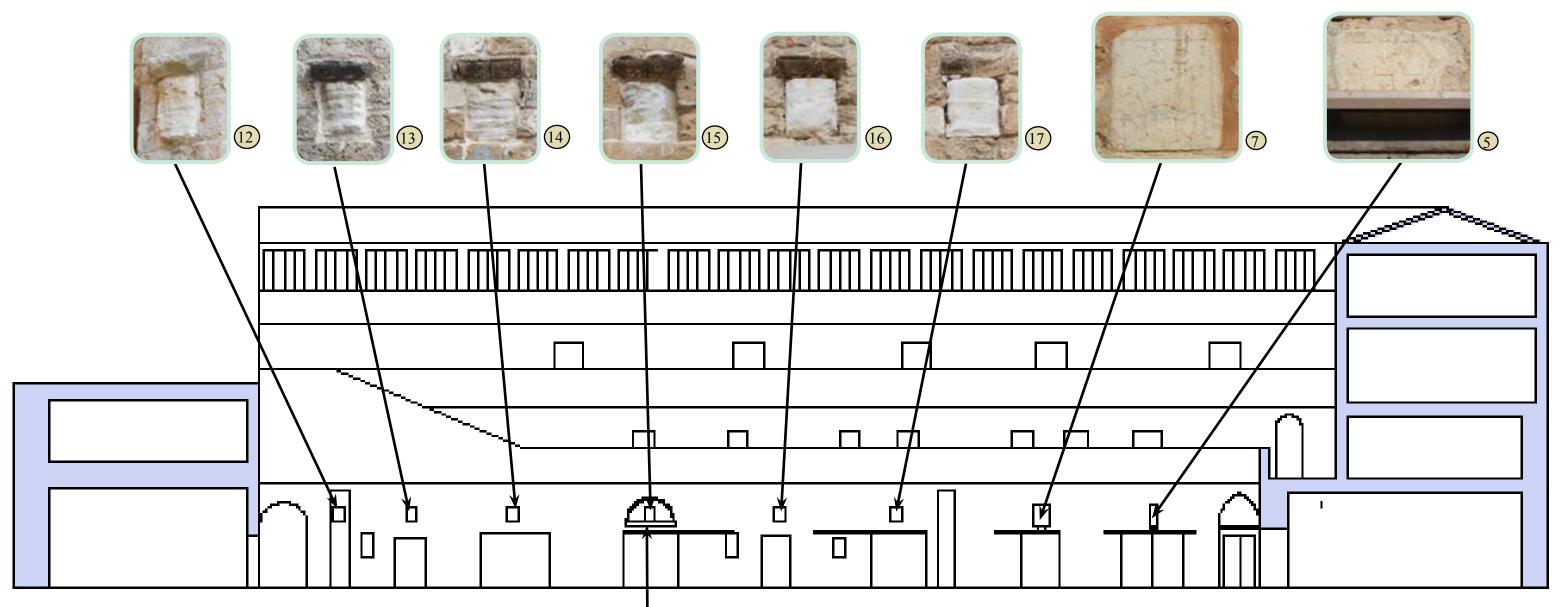




The A.D. 1596 Inscription

2 Franciscan logos with the year1552

3.2 Facade map of the architectural elements


East facade

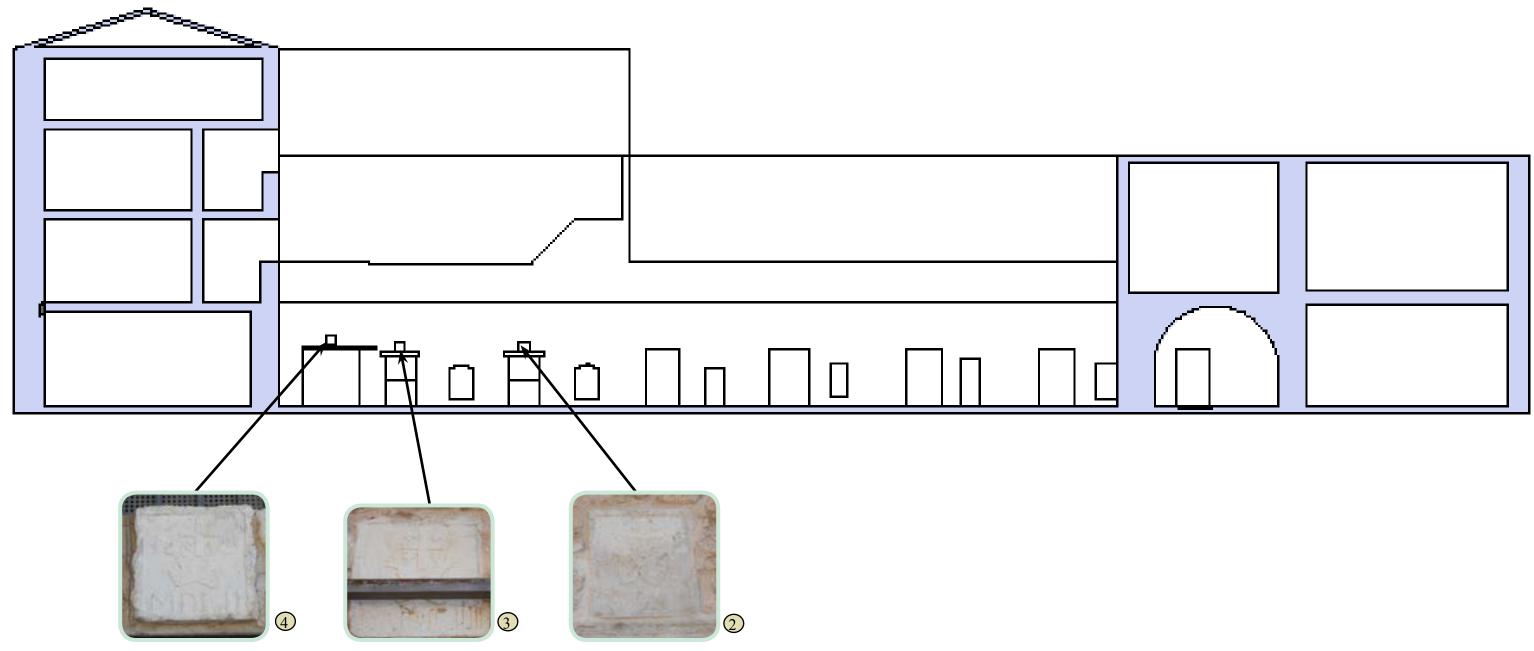

3 Franciscan logos with the year 1552

3.3 Facade map of the stones



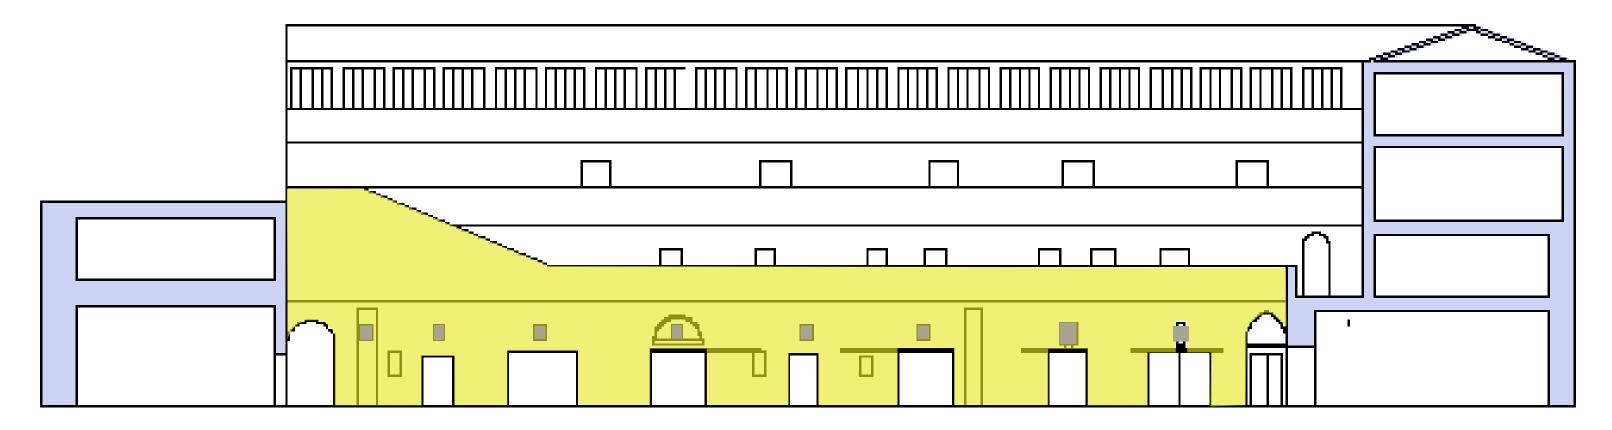


Legend: -Sandstone -Limestone


- Sandstone has been used to build the walls, and the details have been carved in limestone. The walls have been treated with cement, so in some of places the original material is not visible


3.3 Facade map of the stones East facade - -----

Legend: -Sandstone

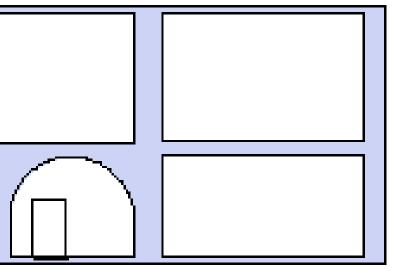

North facade

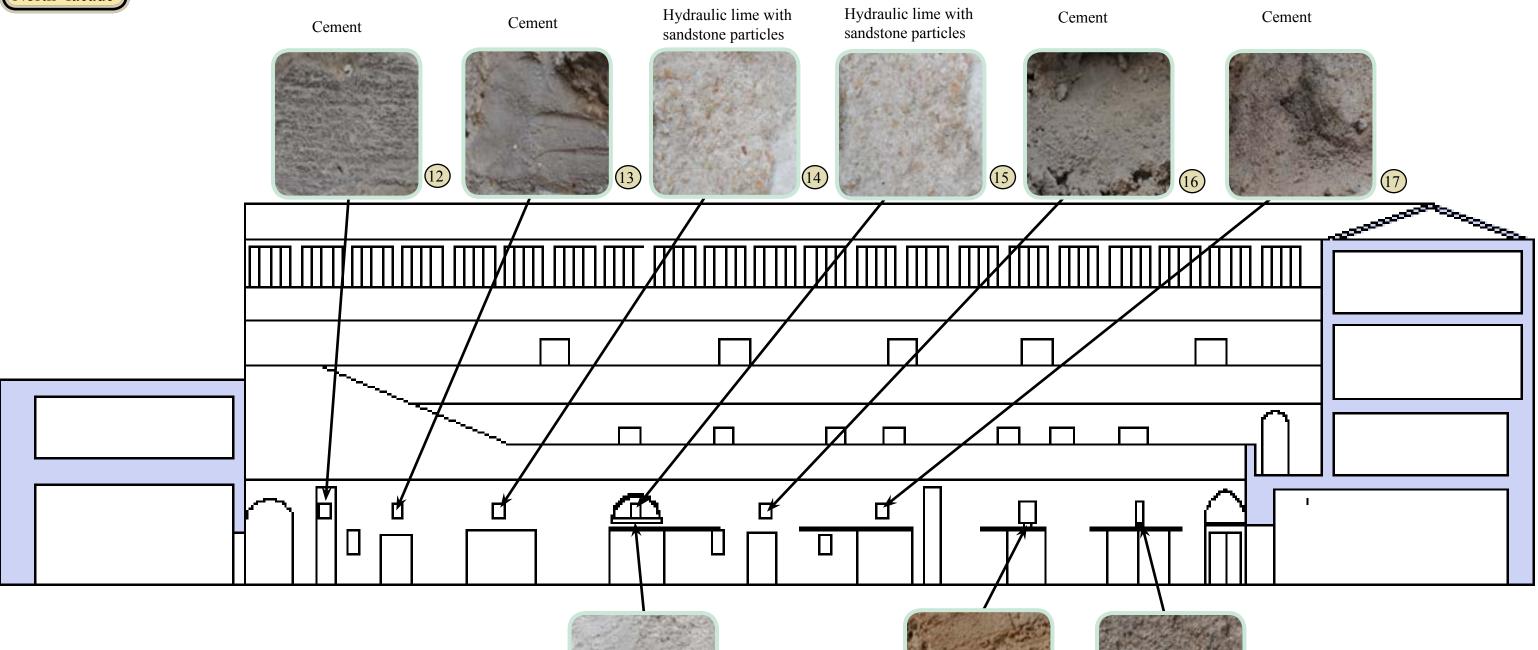

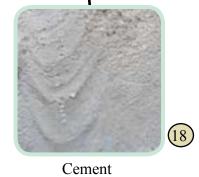




Cement



Lime based mortar with big ceramic, tuf and sand particles

East facade

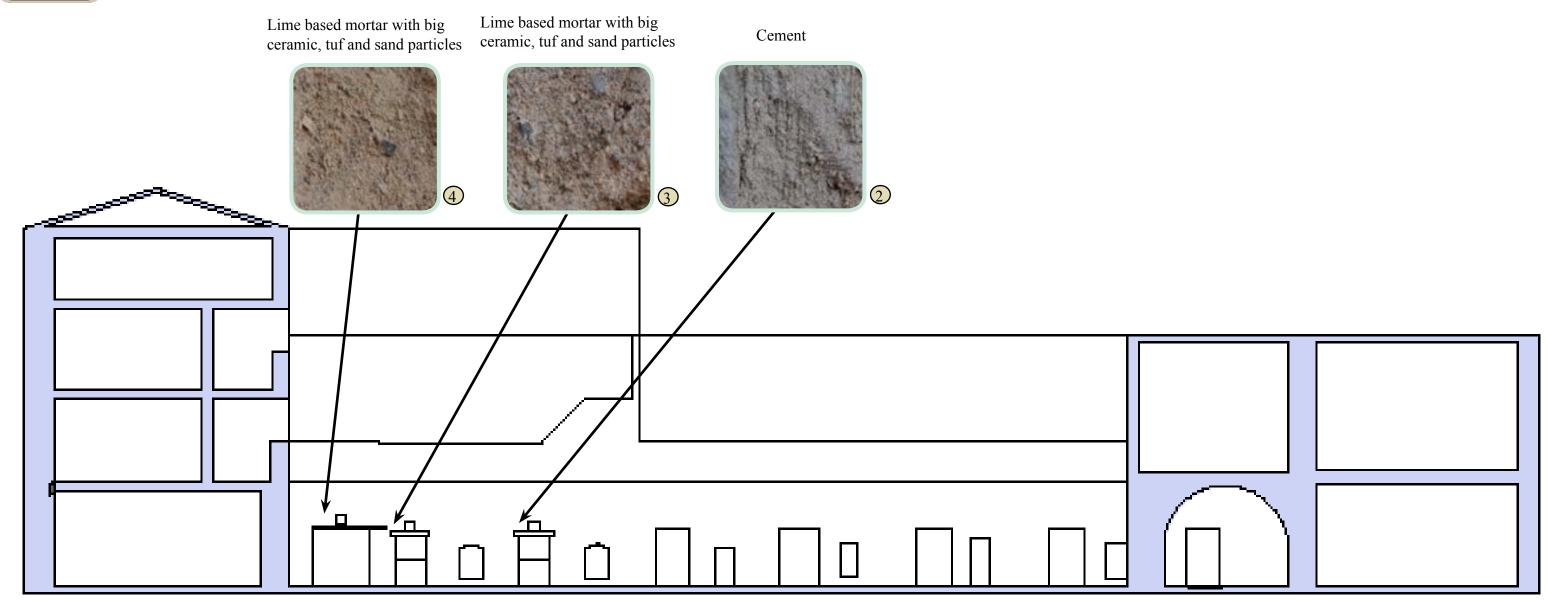

- Cement is the material we can see here the most. There are different kinds of cement used as treatment, so they cover the original material. There is hydraulic lime baed mortar around 2 pilars, and a lime based mortar with ceramic, tuf and sand particles aroun the 3 out of 5 Franciscan logos

A Franciscan logo from 1552, carved in lime-

A Franciscan logo from 1552, carved in limestone with a high historical value. Physical condition: 4

stone with a high historical value.

Physical condition: 4

A winged lion carved in limestone

with a high artistic value. Physical condition: 4

A Franciscan logo from 1552, carved in limestone with a high historical value. Physical condition: 2

3.5 Description and value of the archiectural elements

Physical condition: (1 - the most unstable condition, extremely deteriorated, material is missing; 2 - more stable but highly deteriorated, less material is missing; 3 - there is more material, less deterioration and the element is more stable, 4 - most of the material is present, a little deteriorated, the element is stable 5 is the most stable one, with all of the material present and not deteriorated)

> ⁶ A relief of a cross in limestone on the east outside of the Khan's walls with a high historical value.

Physical condition: 3

A Franciscan logo from 1552, carved in limestone with a high historical value. Physical condition: 2

A cross ingraved into a crusaders stone (inside of the garage, on the north side of the Khan) with a historical value, but less technlogical and artistic values. Physical condition: 2











A Franciscan logo from 1552, carved in limestone with a high historical value. Physical condition: 3









(12)What is it: 6 identical limestone pilars on the (13) Khan's wall with a technological value as they are supporting the northern wall. All of them (14) have a more pronounced ledge. Physical condition: some are in better and some in worse physical condition. Mainly the tops are 16 the parts that are in a somewhat worse physical condition. (17)

Physical condition: 3

An inscription in sandstone: A.D. 1596, placed under an arch and one of the 6 pilars. It has a high technological value due to the way the letters stand in the sandstone. It has an artistic value, and an important historical value.

3.6 Deterioration Patterns

Bird droppings


Discoloration (not original, blue color - probably dropped on the element while coloring the wall next to it) Incrustration Dirt, Incoherent deposit Microbiological attack (visible because of the discoloration of the limestone)

Splashes of mortar/ remains of the conservation material Erosion (loss of original surface, leading to smoothed shapes) Microbiological attack (discoloration of the limestone) Problems with cement intervention Desegregation

Splashes of mortar/ remains of the conservation material Problems with cement intervention Microbiological attack (discoloration of the limestone) Desegregation Erosion (rounding of the edges)





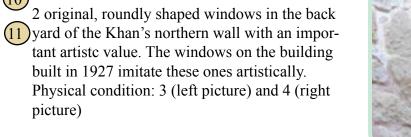

A V shaped sign (not identifiable) ingraved into a crusaders stone (inside of the garage, on the north side of the Khan) with historical value, and less technological and artistic value.

Physical condition: 2

(10)











Problems with cement intervention (detatement of cement - water penetrates and enters the stone) Microbiological attack (discoloration of the limestone) Desegregation



Alveolization

Splashes of mortar/ remains of the conservation material Erosion (loss of original surface, leading to smoothed shapes)



Fe pin (stuck next to the pilar) Disruption Erosion Original mortar deterioration Salt crystallization problems (due to water penetration and cement which does not allow the area to "breathe")

Erosion (loss of original surface, leading to smoothed shapes and rounding of the edges) Problems with cement intervention (the cement is pressuring the limestone)



Disruption Erosion Original mortar deterioration Pulverization Crust (on the pilar) Salt crystallization problems













Disruption Erosion Original mortar deterioration Pulverization Salt crystallization problems

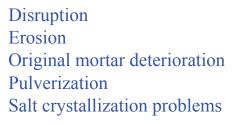

Disruption Erosion Original mortar deterioration Pulverization Salt crystallization problems



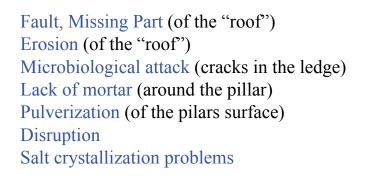



Problems with cement intervention Granular disintegration (often in sandstone) Corosion process (on the letters)







4. The inscription

4.1 The 3D Model

The artistic element is an inscription saying: Anno Domini 1596.



The inscription and its surrounding arch



The inscription and the mortar

THE CONSERVATION PLAN:

the observation of the element
the analysis of the stones and the letters, as well as its surrounding area
the determination of problems and causes

4) the proposition for the treatment















The inscription




Inscription facade drawing




The letters of the inscription

The building technology:

- 1) the sandstone has been carved in the shape of the letter
- 2) hot led has been poured inside of the carving
- 3) the led has expanded after getting cold and it is firmly attached to the sandstone (very strong led, no disattachment problems)

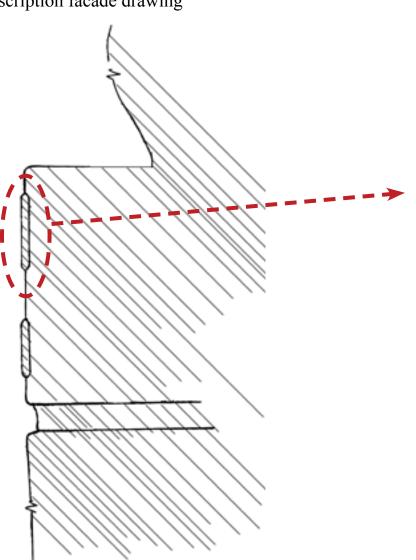

Inscription section drawing

 

Section detail


The pilar and its ledge are causing more problems to the element than the element itself.

3) SALT CRYSTALLIZATION PROBLEMS - the whole north facade has salt crystallization problems

1) WATER DRAINAGE

- through a crack on the ledge water comes in and falls down straight to the inscription sansdstone

- the whole building has got problems with water drainage with needs to e handled first in order to be able to proceed with the intervention

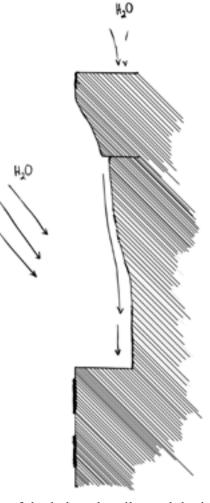

Section of the ledge, the pilar and the inscription stone drawing - to demonstrate how water enters

4) CORROSION ON THE LETTERS

- the time and the weather condition caused corrosion on the led




2) BIO ATTACK

- the bio attack causes the deterioration of the ledge, which leads to waterr penetrating through it and falling down to the sansdstone



Legend: -Corrosion



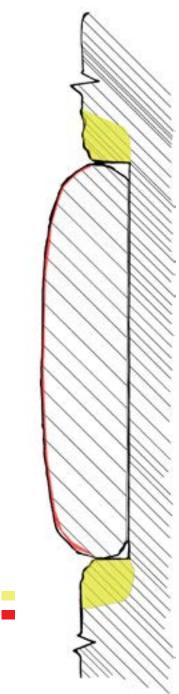

-Deterioration of the sandstone

5) PREVIOUS CEMENT INTERVENTION

- not only does cement pressure the stone and does not allow the area to "breathe", it is also estetically bad - the estetics of this element and it's homogeneity is of big importance



The yellow indicates where the cement should be replaced with hydraulic lime mortar with sandstone particles

6) STONE DETERIORATION

- there are places where the sandstone is more deteriorated due to cement pressure and the water that enters; however the sandstone is in a pretty good condition



The red indicates the deteriorated sandstone

4.4 Proposed solutions and treatment

1) CLEANING OF THE ENTIRE AREA 2) REPAIRATION OF THE LEDGE

- a) to clean the ledge from the biological attack : herbicide, fungicide treatment with ALGAE CONTROL BPS 7111 -apply it with a brush, and after clean it with water
- b) joint filling of the hole in the ledge
- c) impregnation with IDROREPELEN IMPREGNATION MATERIAL

3) STABILIZATION OF THE PILAR

a) to apply a mix of paper powder, EDTA (30 g/L) and bicarbonate amonia (30 G/L) and 1 L of water (apply with hands and wait for an hour an clean with water) b) to close the holes on the limestone pilar with hidraulic lime mortar c) to consolidate the surface of the limestone; apply CALOSIL (Ca(OH)2 + ethanol nano) with a brush and the material will enter the stone nd crystallize 4) CEMENT REMOVAL AND JOINT FILLING a) apply PARALOID B75 (60 g/L) to conservate the stone b) put a gauze around the stone and apply PARALOID B72 (150 g/L)

- c) remove the cement
- d) put the hydraulic lime mortar with sandstone particles where the cement was

5) MECHANICAL CLEANING OF THE LETTERS

a) clean the letters mechanically using a skalpel and a brush

e) when the hidraulic lime with sandstone particles dries put acetone on the gauze and remove it

BIBLIOGRAPHY:

Khan El Faranj and Franciscan Convent's Documentation
 The Italian report from the Universita degli studi di Bari
 Preservation and reconstruction of Acre (Survey and report)
 Percy H. Winter
 Palestine Museum Library
 ICOMOS-ISCS: Illustrated glossary on stone deterioration patterns
 Monuments and sites XV
 Annual State St

Anson Cartwright T., Bourguignon E., Bromblet P., *et. al.* Impression septembre 2008, Ateliers 30 Impression, Champigny/Marne, France

ACKNOWLEDGEMENTS:

The author would like to thank Jacques Neguer, Mark Avrahami, Tsili Giadi, Eran Mordohovich, David Zell, padre Quirico and the participants of Saving the Stones VI for their help, patience and useful advice.